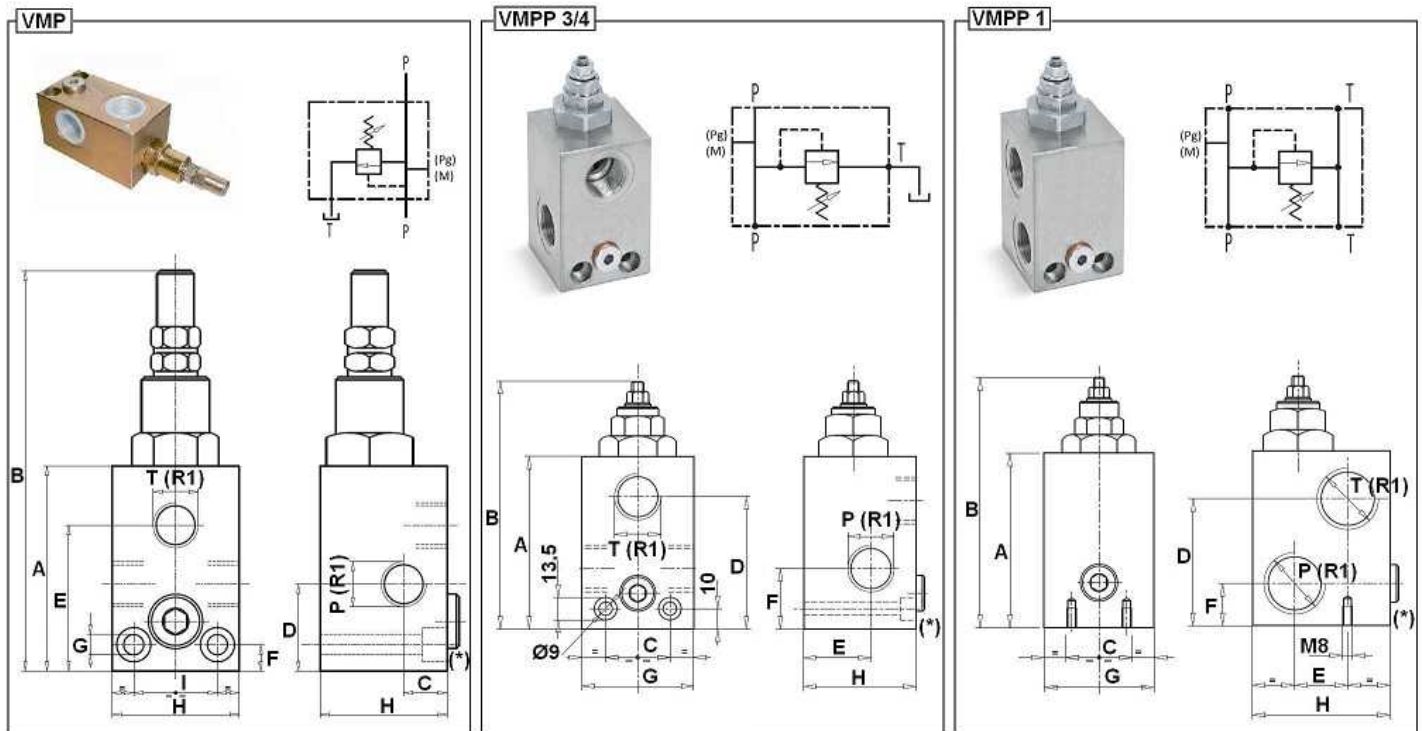


Pressure relief valve in line (screw control) steel**1/1****Body:** Zinc-plated steel**Max.press:** 400 bar

Part nº	R1	Max. flow (l/min)	Max. Press. (bar)	Setting (bar)	Reg. rate (bar)	Press. increase (bar/turn)	A	B	C	D	E	F	G	H	I
VMP 3/8 50-250BAR	3/8"BSP	45	250	130	50-250	45	72	134	15	26	49,5	8,5	6,5	40	26
VMP 3/8 80-300BAR	3/8"BSP	45	300	150	80-300	50	72	134	15	26	49,5	8,5	6,5	40	26
VMP 1/2 50-250BAR	1/2"BSP	70	250	130	50-250	45	77	139	17,5	29,5	54	8,5	6,5	45	30
VMP 1/2 80-300BAR	1/2"BSP	70	300	180	80-300	50	77	139	17,5	29,5	54	8,5	6,5	45	30
VMP 3/4 50-250BAR	3/4"BSP	90	250	130	50-250	45	92	154	17,5	35	68	10	8,5	50	32
VMP 3/4 80-300BAR	3/4"BSP	90	300	150	80-300	50	92	154	17,5	35	68	10	8,5	50	32
VMPP 3/4 20-200BAR	3/4"BSP	120	400	180	20-200	45	94	135	32	72	35	32	60	60	-
VMPP 3/4 50-400BAR	3/4"BSP	120	400	180	50-400	80	94	135	32	72	35	32	60	60	-
VMPP 1 50-400BAR	1"BSP	160	400	180	50-400	80	94	135	30	69	34	23	60	80	-

(*) You can adapt a gauge on this side outlet threaded 1/4 ".