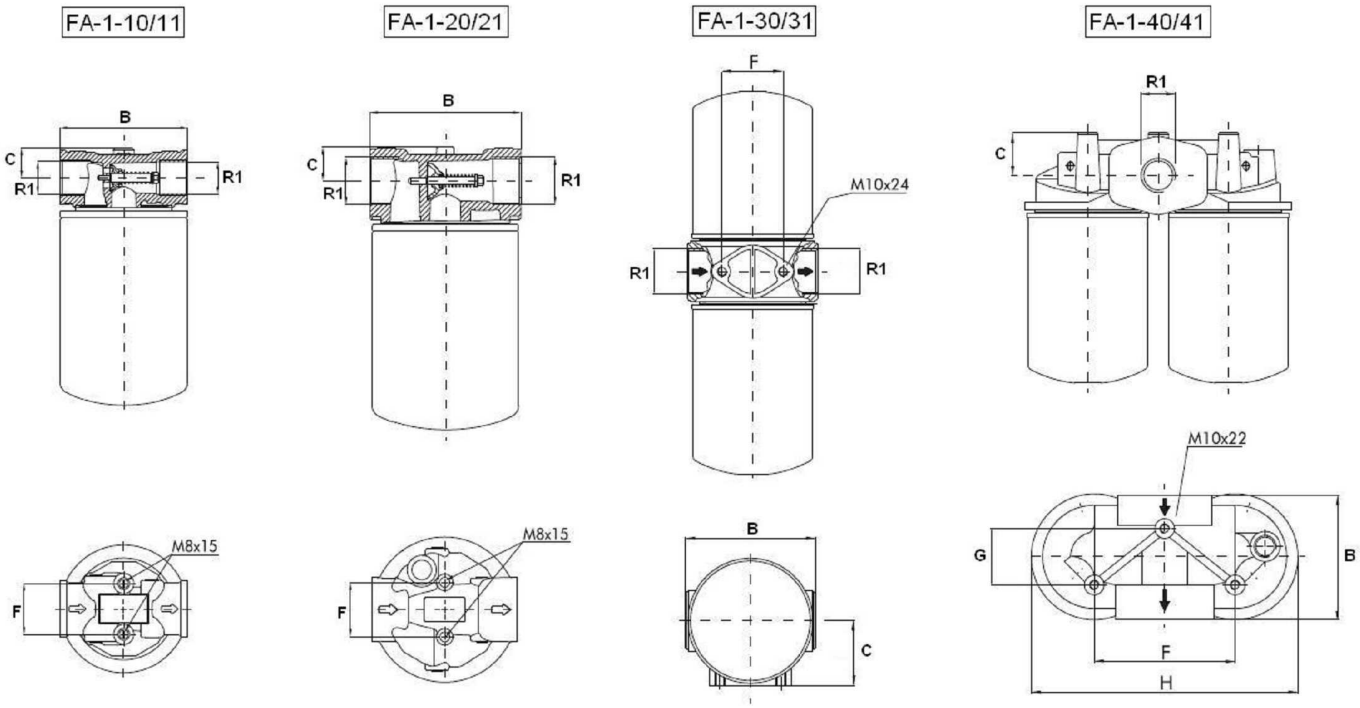

By-pass in Suction line: 0,25 bar

By-Pass in Return line: 1,7 bar

As per NFPA T 3.10.17: Max.pressure:12 bar
Test pressure: 15 bar
Burst pressure:20 bar

WorkingTemperature: De -25ºC a 120ºC

Materials: Head-aluminium
Housing-carbon steel
Seal-Buna-N

Part nº	R1	Type	Cartridge	B	C	F	G	H
FA-1-10/11-A	3/4" BSP	ASPIRACION	SPA-1-10 - SPA-1-11	95	22	38	-	-
FA-1-20/21-A	1"1/4 BSP	ASPIRACION	SPA-1-20 - SPA-1-21	133	30	50	-	-
FA-1-30/31-A	1"1/2 BSP	ASPIRACION	SPA-1-20 - SPA-1-21	140	70	65	-	-
FA-1-40/41-A	1"1/2 BSP	ASPIRACION	SPA-1-20 - SPA-1-21	132	46	150	60	284
FA-1-10/11-R	3/4" BSP	RETORNO	SPA-1-10 - SPA-1-11	95	22	38	-	-
FA-1-20/21-R	1"1/4 BSP	RETORNO	SPA-1-20 - SPA-1-21	133	30	50	-	-
FA-1-30/31-R	1"1/2 BSP	RETORNO	SPA-1-20 - SPA-1-21	140	70	65	-	-
FA-1-40/41-R	1"1/2 BSP	RETORNO	SPA-1-20 - SPA-1-21	132	46	150	60	284

For the FA-1-30/31 and FA-1-40/41 shells, TWO cartridges will be placed.
The by-pass valve is included.

The information gathered in this technical documentation (Catalogue) has an informative character and can be modified without previous notice. DICSA will not accept any type of responsibility resulting from an inappropriate use of the product, except the ones related to manufacturing defects.